

**TECHNCIAL NOTE no.: 22**


Product:	Gearbox Shifting pneumatic system
Part number:	5FR798001
To:	CUPRA Leon Competicion & Audi RS3 LMS
Date:	21/10/2021

During the 2021 season, there have been some reports regarding a fault in the shifting compressor air temperature sensor, noting air leaks through the sensor in some units.


You will be able to detect it:

- a) Because you will see that the silicon seal of the cable has been lifted.
- b) Because the compressor starts very often (check no leakages in the line)

1) Air Temperature sensor in location

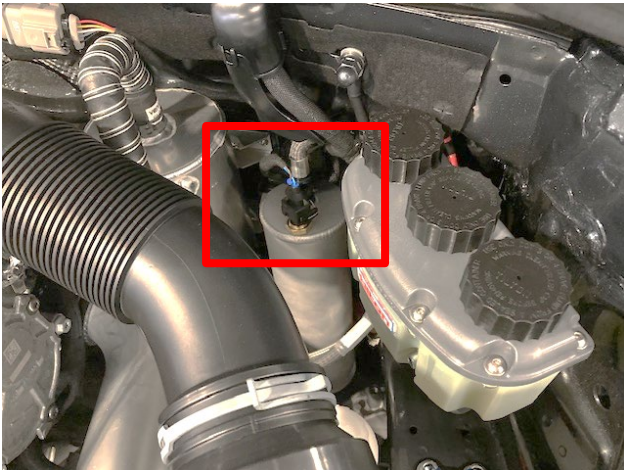

2) Silicon seal lifted due sensor air leaking

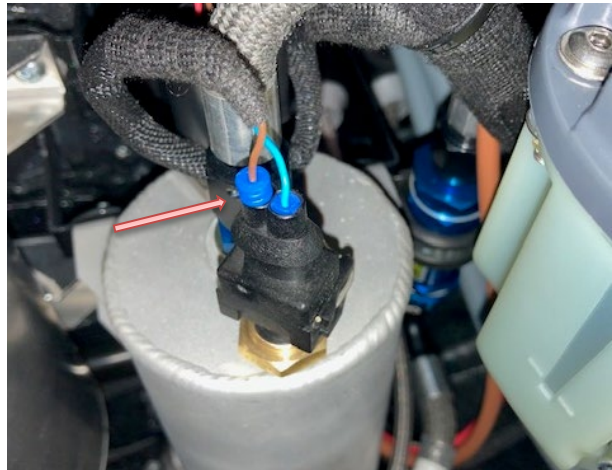

The temperature value of the compressed air accumulator is used for information only, is not used for any shifting system strategy.

In the future, that sensor will be an optional part and a cap will be installed in replacement of the sensor. The connector on the wiring loom will remain in the car.

Hewland Temperature sensor part no.: **ELC-026-v1**